
M109A6 Paladin . . .

Snub the Rub!

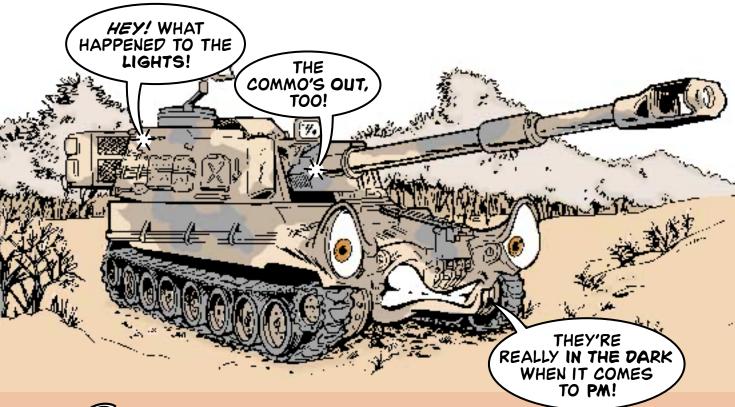


Crewmen, after you've cleaned the


segment board on your Paladin, you're supposed to remove the green pad from the cleaning block. Just make **very** sure that you get the block locked back down on the cleaning mechanism afterward.

If it's not locked down properly, vibration makes the cleaning block pop up. In that position, the cleaning block rubs against the segment board until—zap!—the segment board shorts out. You're left without turret power or commo.

Ensure the cleaning block is locked down by eyeballing it. Look for a slight gap between the cleaning block and the cleaning mechanism. A gap means the

cleaning
block is
not locked
down.
Try again.
No
gap? The
cleaning
block is
locked

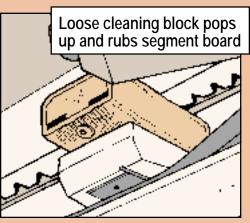

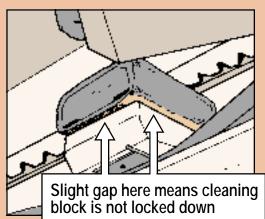

down and you're good to go.